


How to improve R7F Receiver
narrowing IF band width similar to R6F.

適用機種	組
JR72FN	K.1
JR74FN	K.1

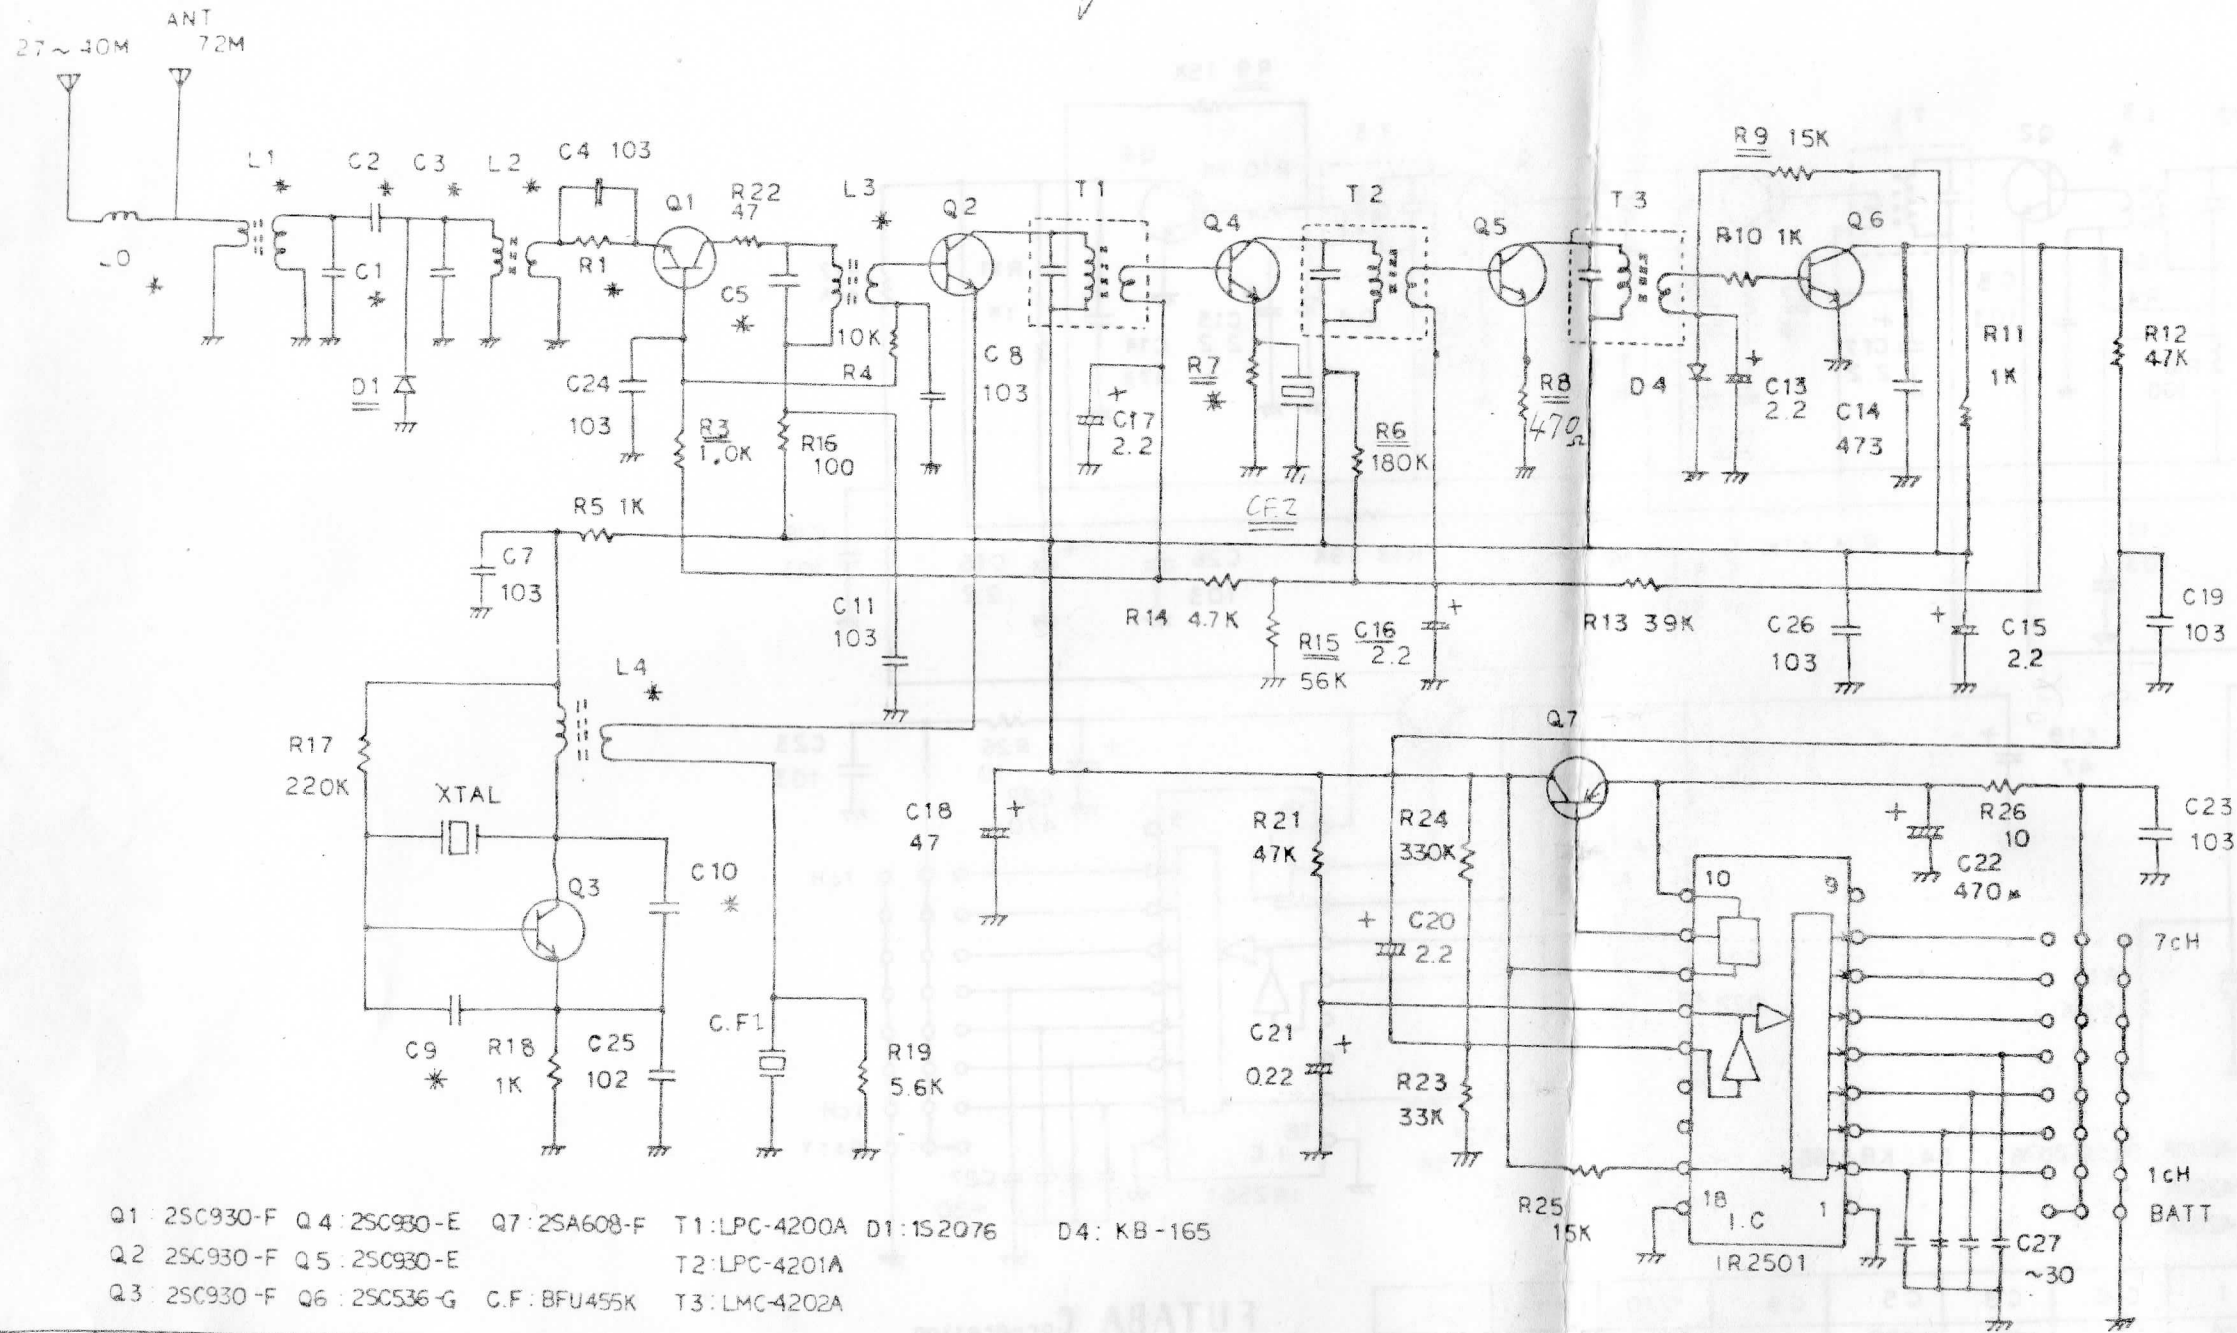


Q1: 2SC930-F Q4: 2SC930-E Q7: 2SA608-F T1: LPC-4200A D1: 1S2076 D4: KB-165
 Q2: 2SC930-F Q5: 2SC930-E T2: LPC-4201A
 Q3: 2SC930-F Q6: 2SC536-G C.F: BFU455K T3: LMC-4202A

F	*	L0	L1	L2	L3	L4	C1	C2	C3	C5	C9	C10	R1	R7
27M	*	FL3H2R2M	L-40140	L-40150	L-40140	L-27130	N470 47p	CH22pF	N470 47p	N470 47p	CH15p	NPO 33p	2.2KΩ	1KΩ
35M														
40M	*	FL3H2R2M	L-40140	L-40150	L-40150	L-27130	RH22p	CH1pF	RH22p	RH22p	CH15p	CH15p	2.2KΩ	1KΩ
72M		L-72160	L-72160	L-72160	L-72130		RH27p	CH1pF	RH27p	TH25p	CH10p	CH15p	2.2KΩ	1KΩ

FUTABA Corporation

RECEIVER CIRCUIT . FP-R7F
 DIAGRAM . FP-R107F
 P.C Board : R-63B
 K.1 81.3.11

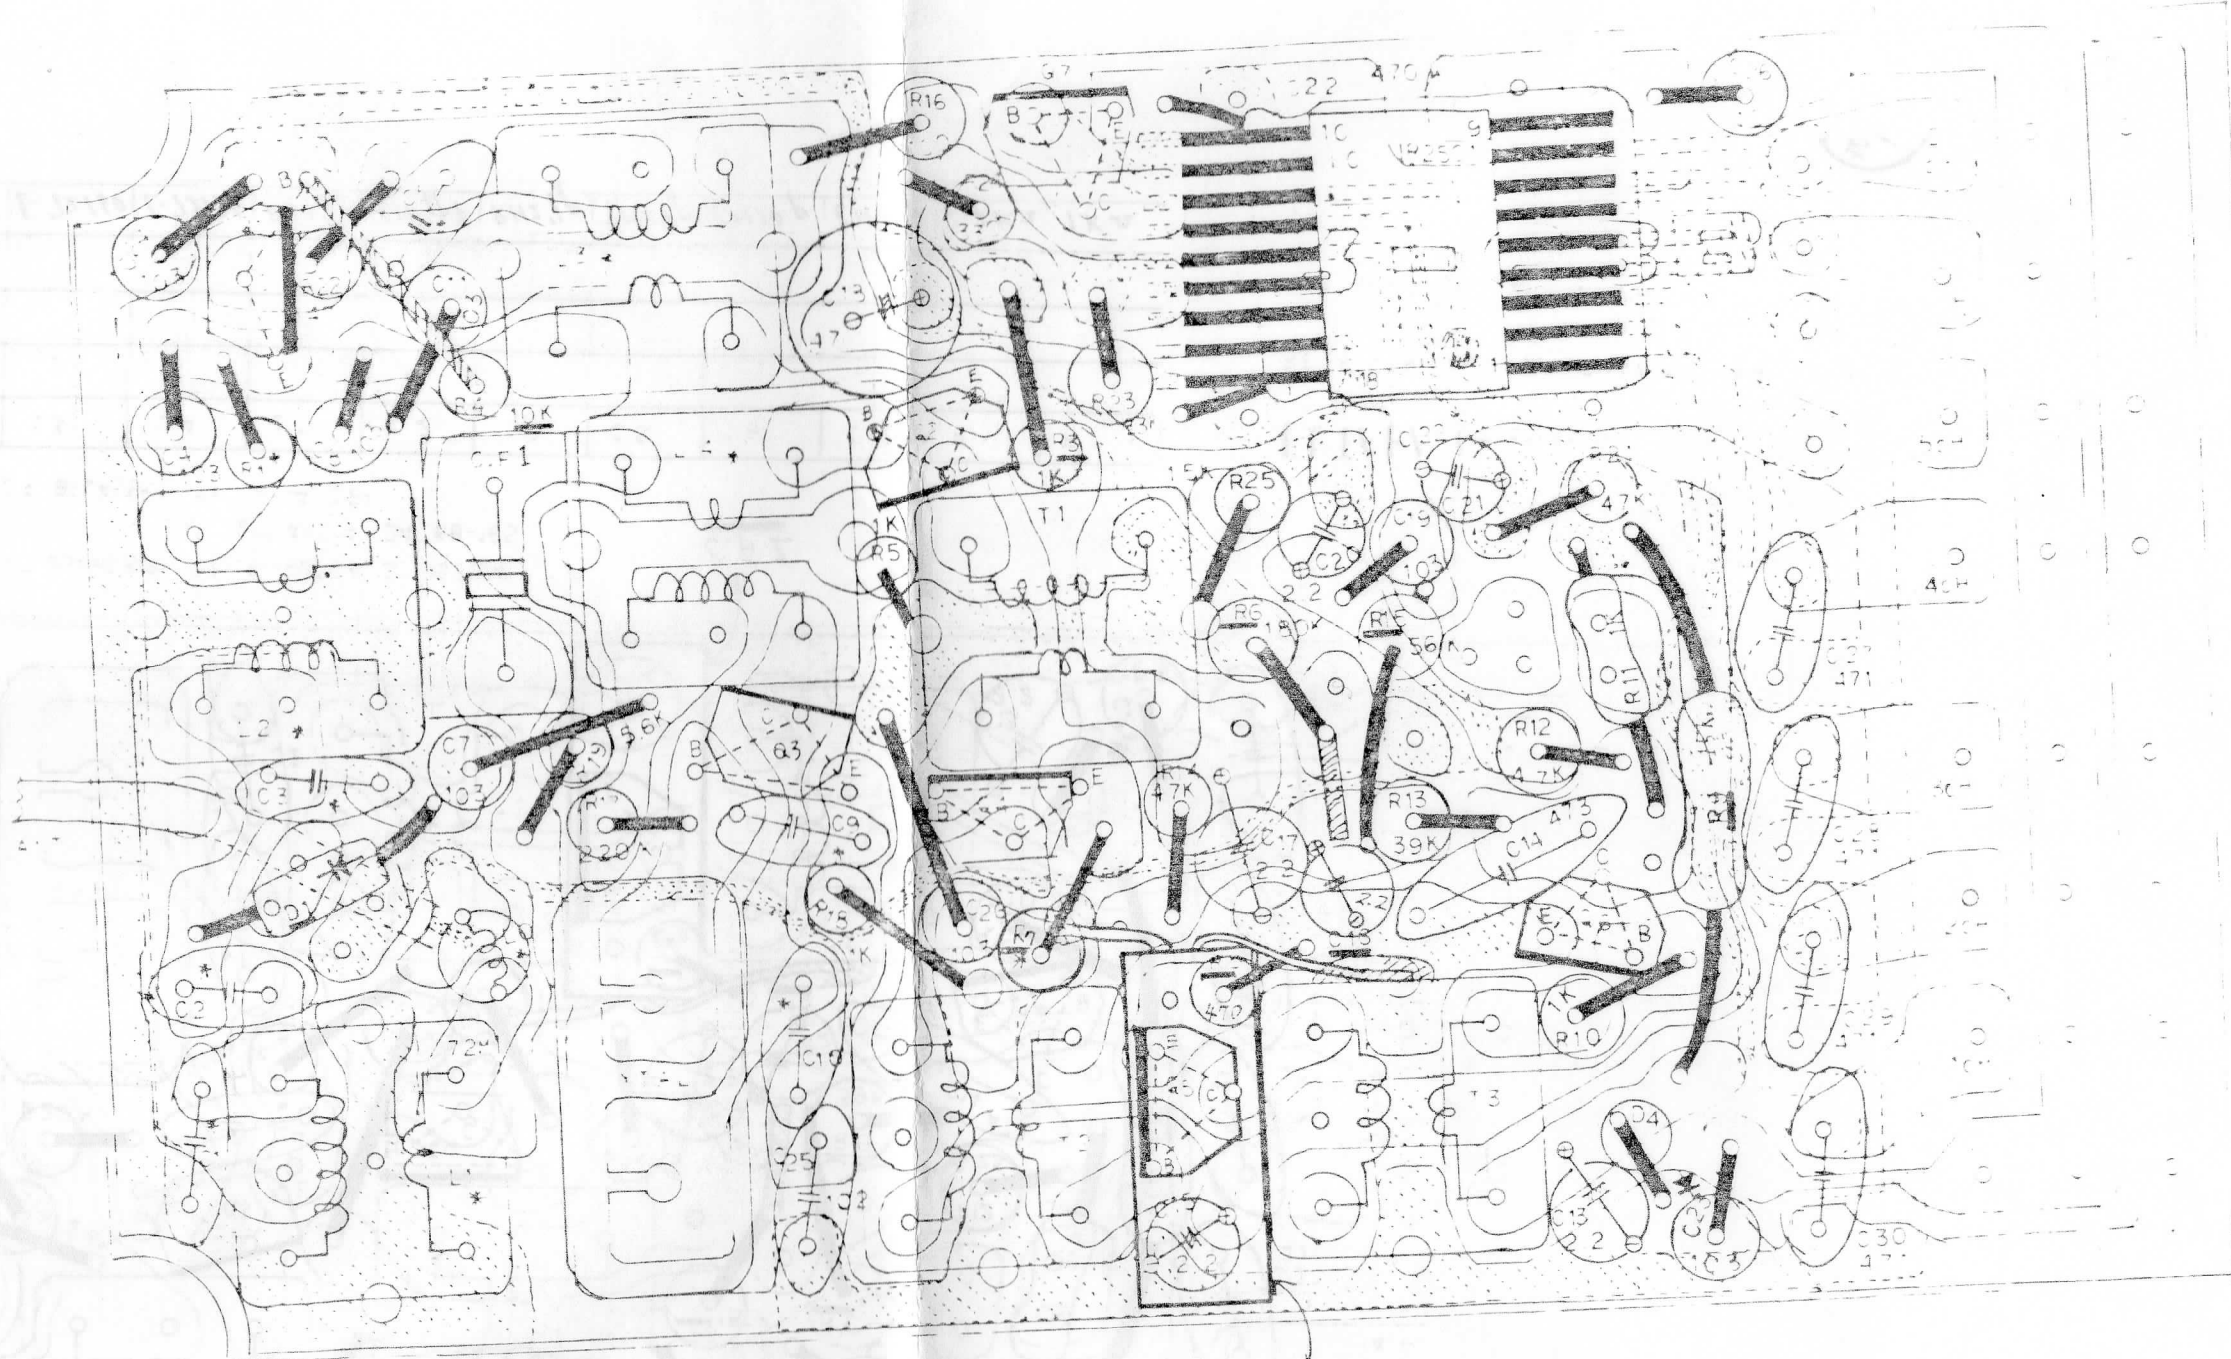

- Q1 2SC930-F Q4 2SC930-E Q7 2SA608-F T1 LP-420A D1 1S2074
 Q2 2SC930-F Q5 2SC930-E L1 LP-420A D4 KB-165
 Q3 2SC930-F Q6 2SC930-E C.F. BFL455X T2 LP-420A

C.F.I.

	L1	L2	L3	L4	C1	C2	C3	C5	C9	C10	R1	R2
72M	L-72160	L-72160	L-72160	L-72130	RH27P	CH1PF	RH27P	TH25P	CH10P	CH15P	2.2K Ω	1K Ω

FUTABA Corporation
 REPAIR INSTRUCTION DRAWING
 F.C. Board